


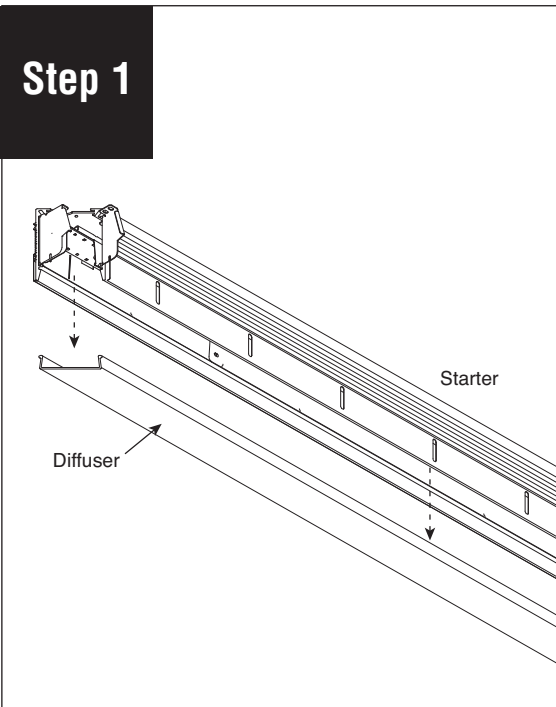
HP-2 Recessed T-Bar Mitered Corner Installation Instructions

Scan QR code for helpful video(s)




0 - 10V Dimming

Step 1




Remove diffuser and set aside to prevent it from getting dirty or damaged.

Step 2

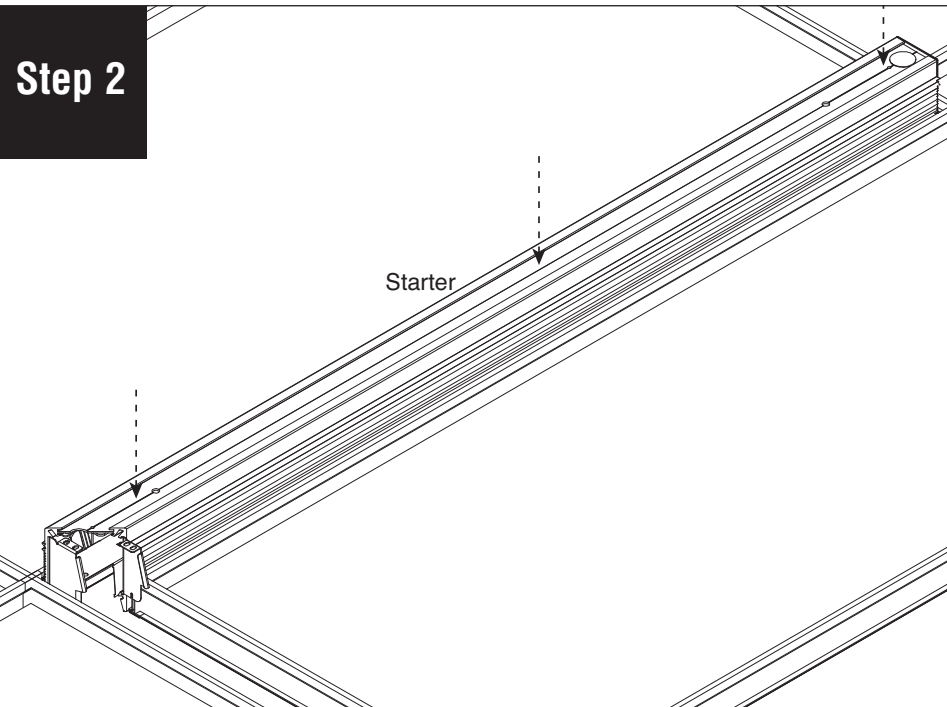


Install starter luminaire on to T-Bar.

Step 3

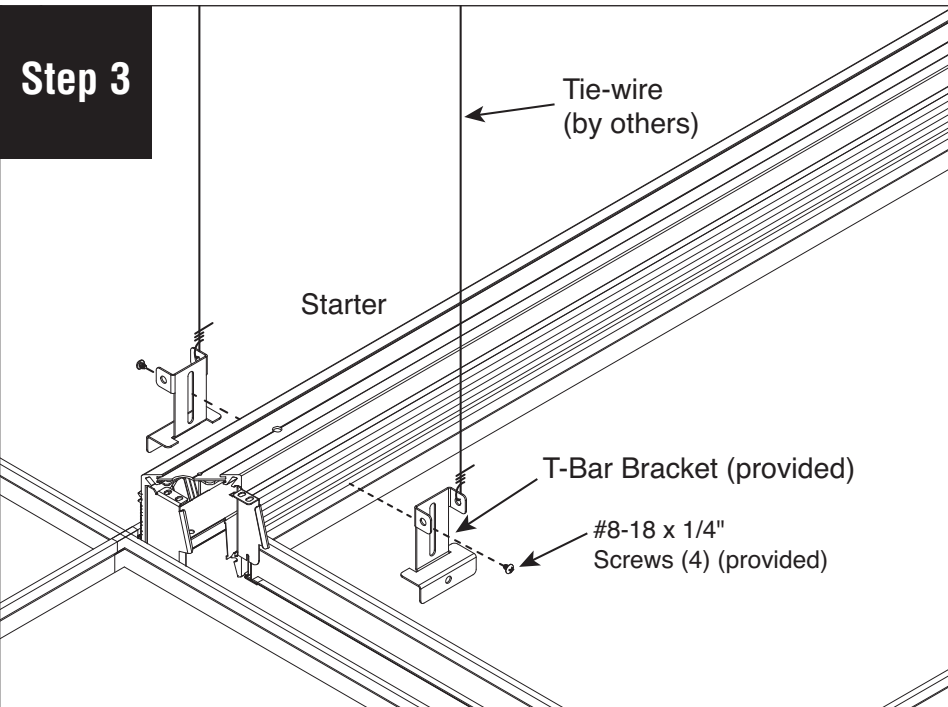


Attach T-Bar bracket (provided) to luminaire with #8-18 x 1/4" screw (provided). Secure luminaire to structure using tie-wire (by others), as per code.

Step 4

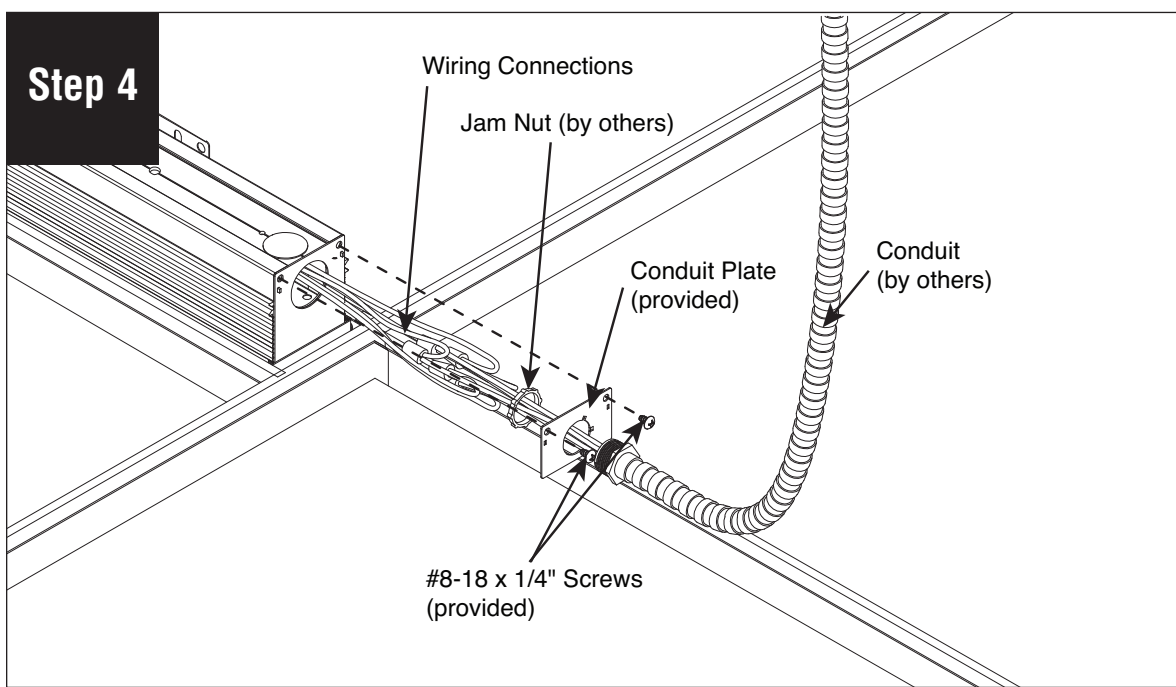


Remove conduit plate then install wiring through conduit plate and through jam nut. Secure jam nut onto conduit. Make wiring connections and then reinstall conduit plate.

OPTIONAL SPLICE BOX

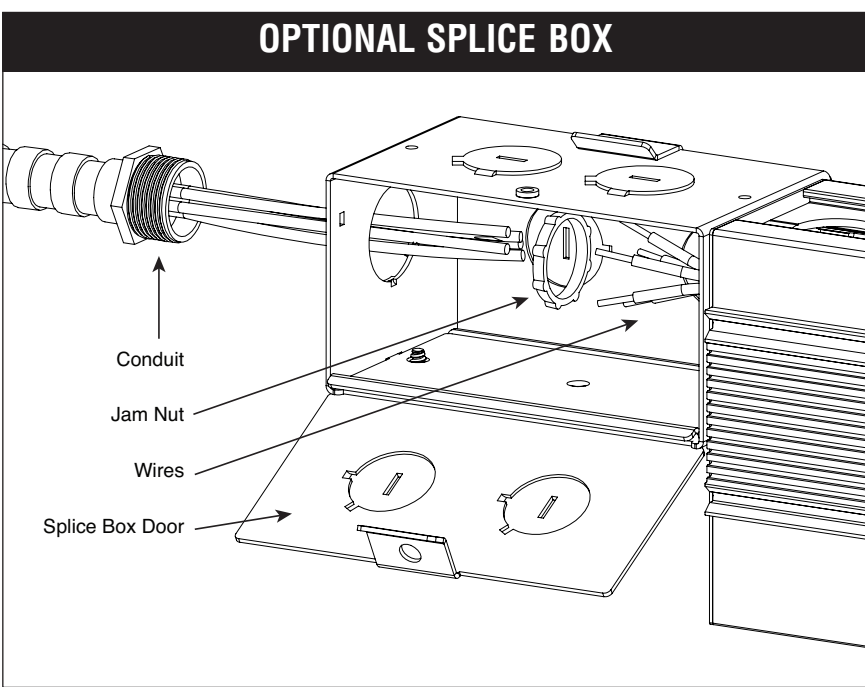

Open optional splice box door to access wiring.

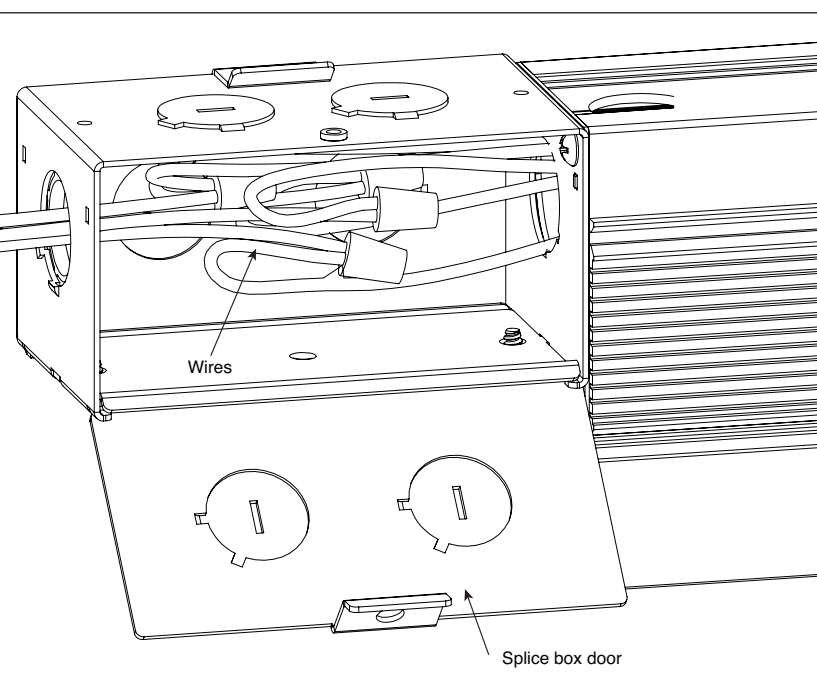


Run power cable through knock-out. Make electrical connections. Secure conduit on to splice box with jam nut and close splice box door.


Protected by one or more US Patents: 8915613; D702,391; D702,390; D700,732; D727,564 S; D727,560 S; D727,551 S

© 2016 FINELITE, INC. ALL RIGHTS RESERVED. Form 98240 V2. 11/16


HP-2 Recessed T-Bar Mitered Corner Installation Instructions

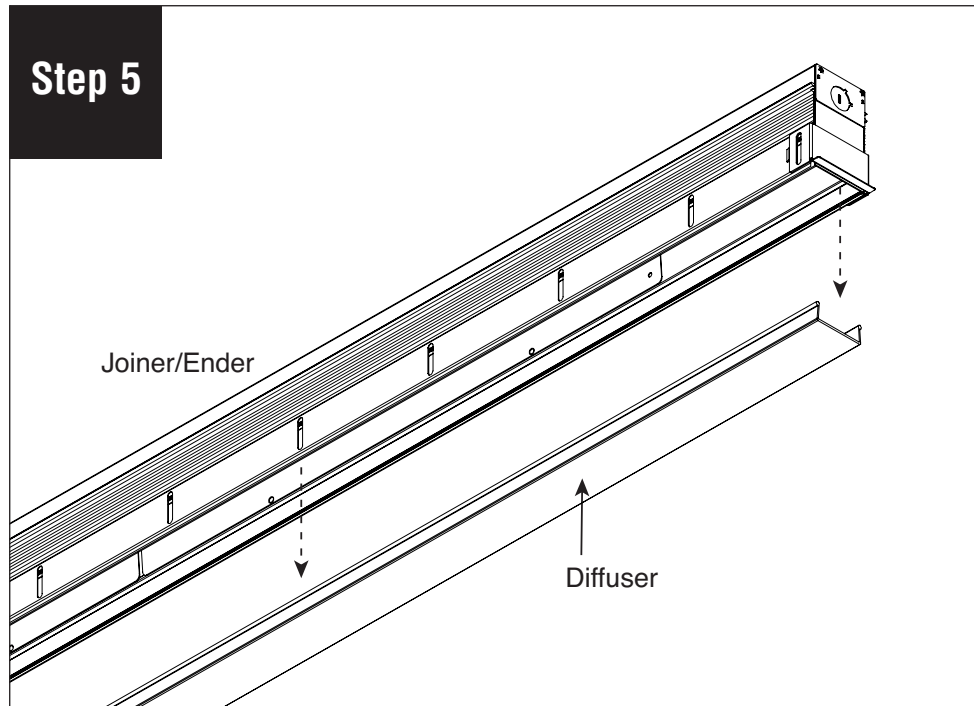


Remove diffuser from joiner/ender luminaire and set aside to prevent it from getting dirty or damaged.

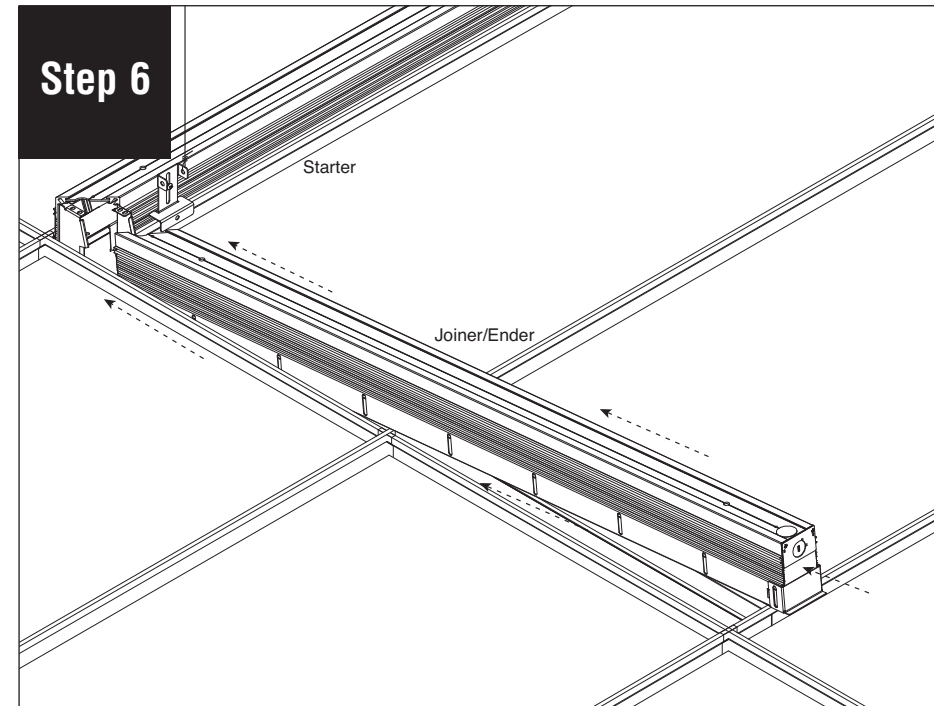


Slide joiner/ender luminaire onto T-Bar.

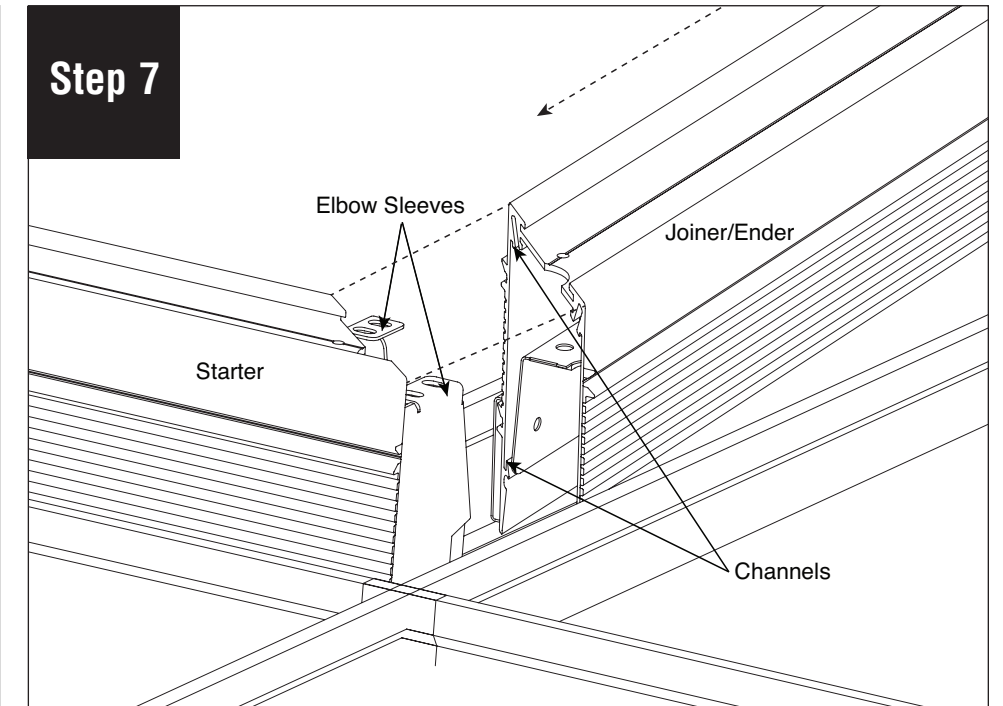


Align elbow sleeves with channels in body. Slide joiner/ender onto starter.

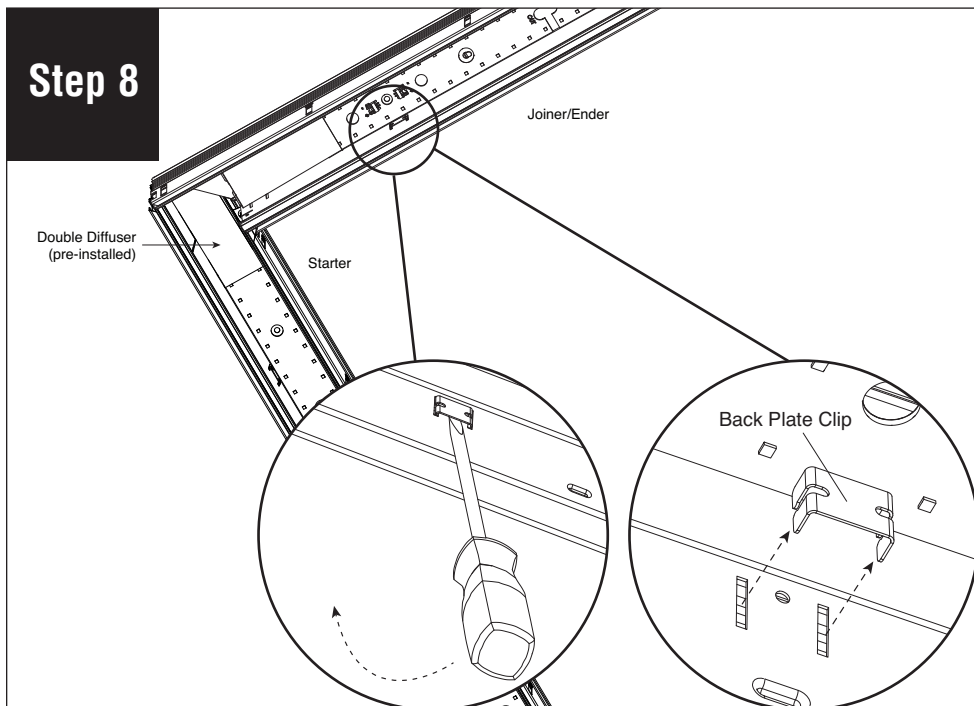

Remove back plate clips (provided) from back plates at corner joint.

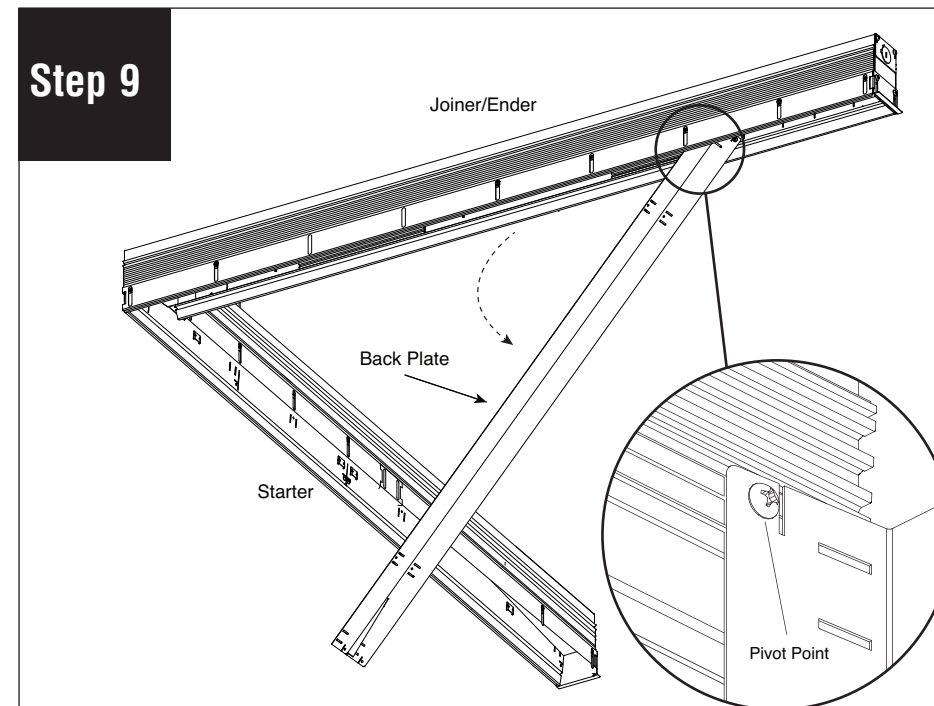


Slowly swing down back plates. **CAUTION: Do not twist back plate when swinging down - it will come out of the support extrusion.** Note that the screw shown is the pivot point and the back plate can be slid a few inches either way for ease of access to the driver space.

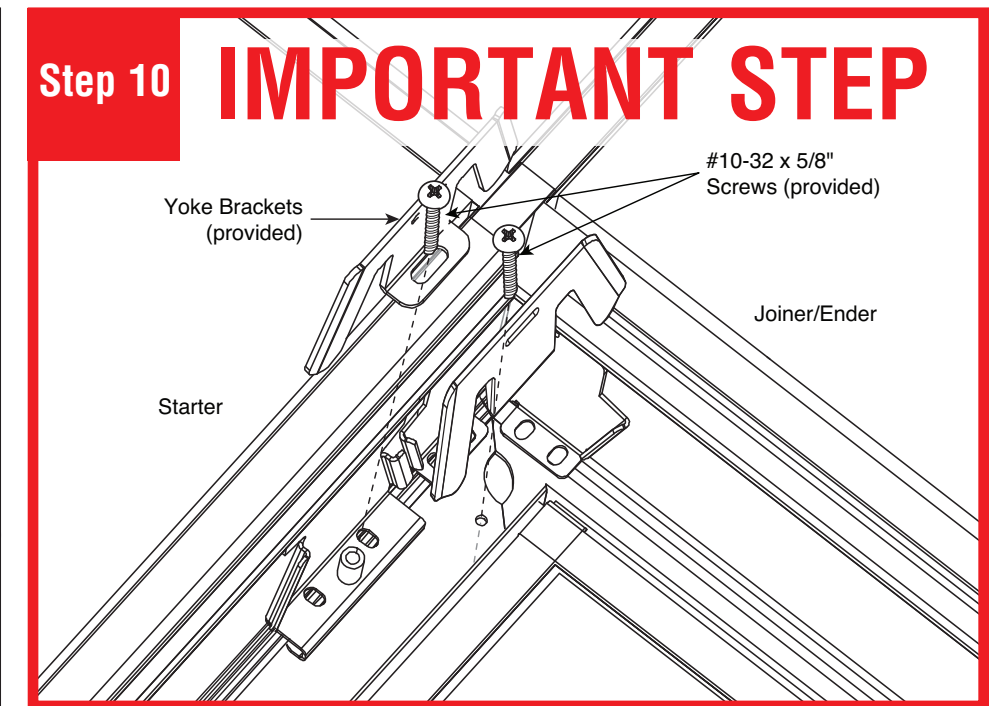


IMPORTANT STEP: Secure joint with two yoke brackets (provided) using #10-32 x 5/8" screws (provided). **CAUTION:** When installed correctly these brackets will pull luminaires together to make a tight joint. Do not over-tighten.

Note: All power connections to be installed to local/national codes by a Certified Electrician.


HP-2 Recessed T-Bar Mitered Corner Installation Instructions

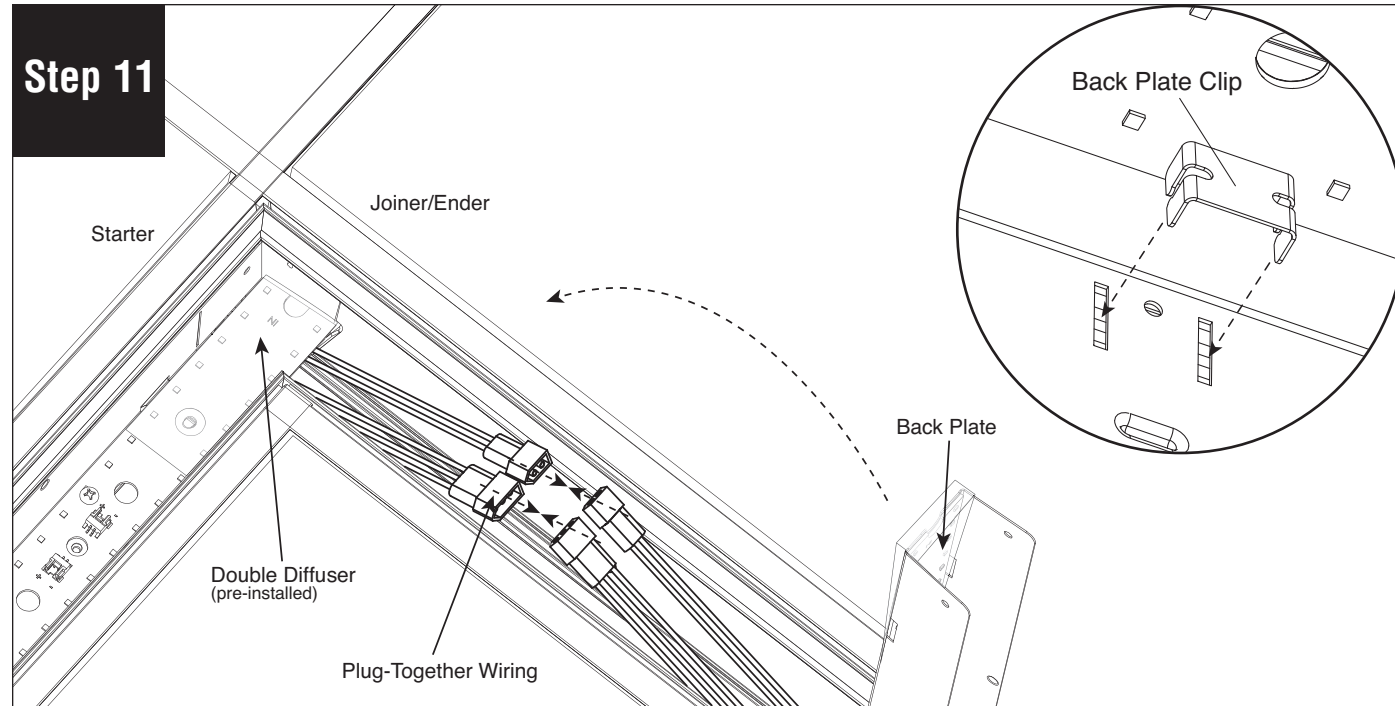

Connect plug-together wiring. Close all back plates by pushing them back in their original position and pushing the clips back in.

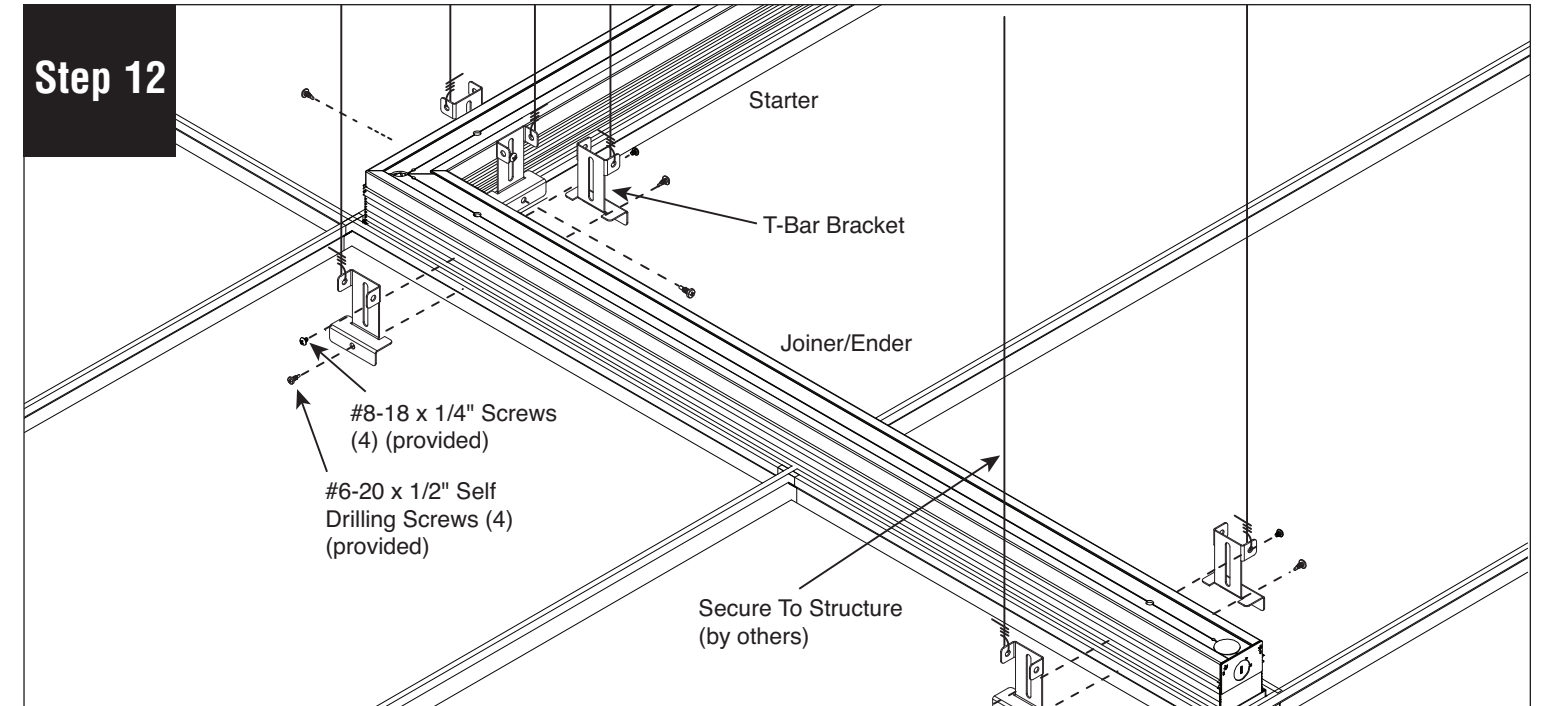

Attach T-Bar bracket (provided) onto joiner/ender with #8-18 x 1/4" screws (provided). Secure joiner/ender to structure using tie-wire (by others), as per code. Secure all luminaires to the T-Bar by driving #6-20 x 1/2" self drilling screws (provided) through the T-Bar brackets (provided) into the T-Bar.

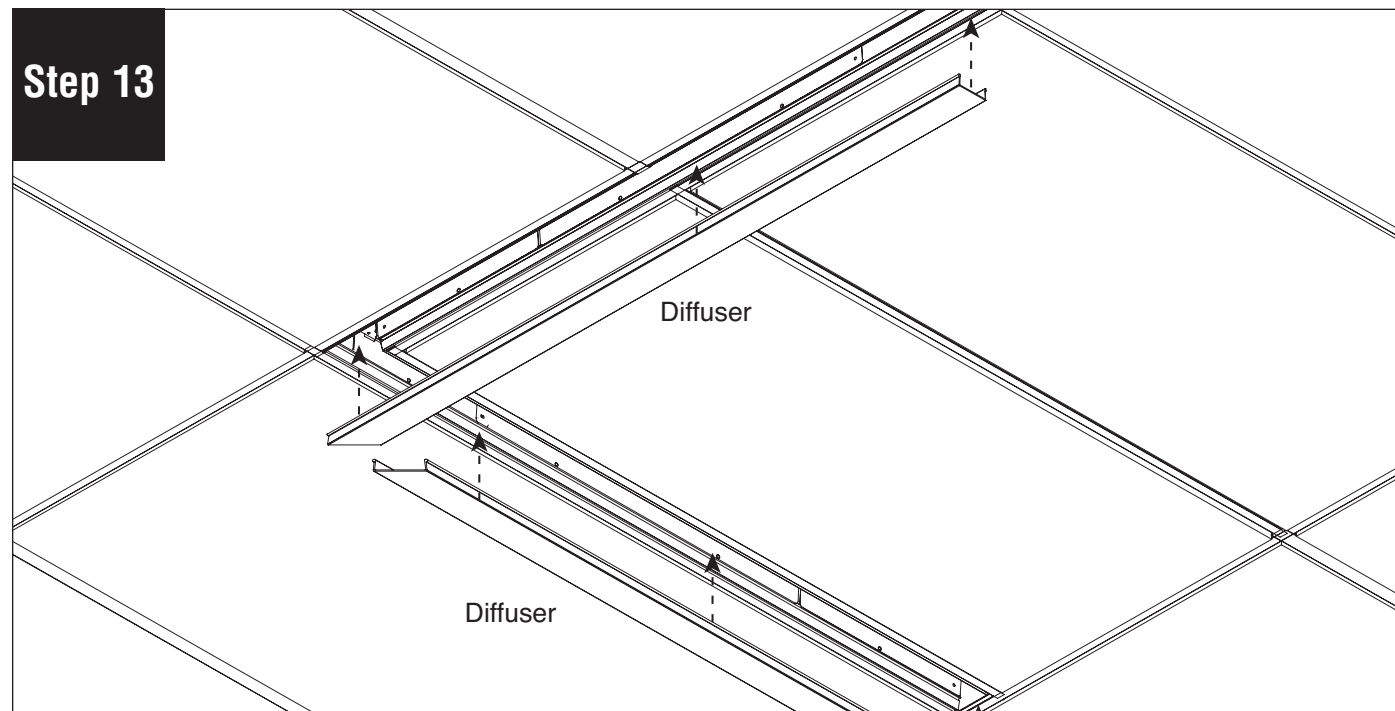

Reinstall diffusers and turn power on to luminaires.

Note: All power connections to be installed to local/national codes by a Certified Electrician.